



Field Bulletin

- Boot Software Update
- SC66XX US PROM Units

Bulletin #:	FG00606
Bulletin Date:	May 11, 2006
Subject:	Boot Software Update
Affected Model(s):	SC66XX US

Summary:

SC66XX PROM units with older Boot Software (Bill Validator’s Internal Operating Software), Prior to version 1.06 will be required to have their Boot Software updated to the latest version (1.13) Before installing the new \$10 software.


NOTE: This issue does not effect SC66XX Flash units

Detail:

Any SC66XX PROM US that has a Boot Software of V1.05 or earlier are required to update to the latest version of Boot Software (1.13). the older Boot Software is not compatible with the new \$10 PROM Software. Placing a PROM with the new \$10 software into a unit with V1.05 or older Boot Software will cause the unit to appear locked up and all three MMI LED’s will illuminated. Placing the previous version of software back in the unit will allow the unit to operate properly till the Boot Software can be updated into the unit.

SC66XX PROM units with Configuration Code 06 or lower indicates that the update is required. The serial number of the Acceptor contains the Configuration Code of the unit. The serial number of the Acceptor Module can be found on the sticker located on the bottom of the acceptor module (See below).

WW Y L CC #####

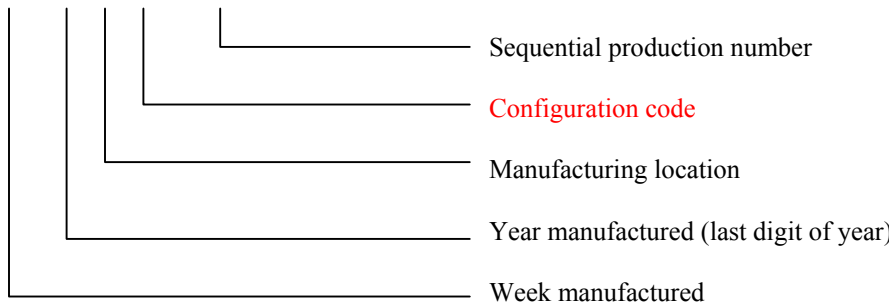

Questions should be directed to MEI Technical Support at 1-800-345-8172 or our web site: www.meiglobal.com

ACTION:

- A MEI or AESI technical representative can only perform this update.
- To have units updated with the latest Boot Software, please contact your local MEI or AESI Technical representative.

AESI Contact Information
6285 S. Mojave Road, Suite E
Las Vegas NV. 89120
Toll free: 866-736-AESI (2374)